



- Machine Taps
- Tarauds machine

- Maschinen-Gewindebohrer
- Machos de máquina

- Machinetappen
- Macho de Máquina

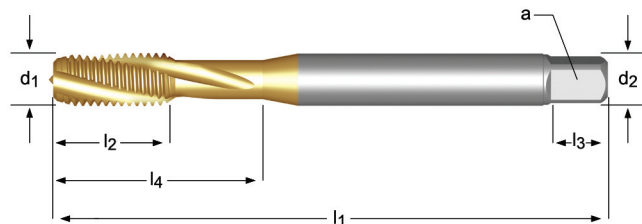


E212




- 1.3 1.4
- 1.1 1.2 1.5 4.2 4.3 7.2 7.3

M	P mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	□ a mm	l ₃ mm	z	↔	l ₄ mm	e-Code
3	0,50	56	9	3,5	2,7	6	3	2.5	18	E212M3
4	0,70	63	11	4,5	3,4	6	3	3.3	21	E212M4
5	0,80	70	13	6,0	4,9	8	3	4.2	25	E212M5
6	1,00	80	15	6,0	4,9	8	3	5	30	E212M6
8	1,25	90	18	8,0	6,2	9	3	6.8	35	E212M8
10	1,50	100	20	10,0	8,0	11	3	8.5	39	E212M10

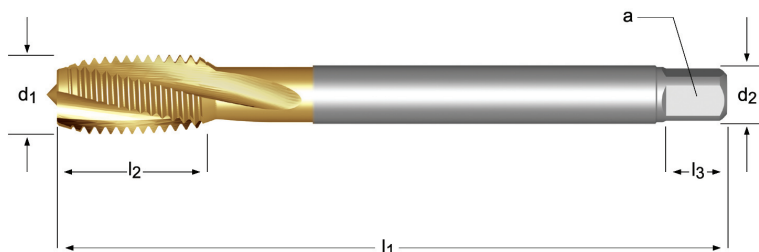

E263



- 1.3 1.4
- 1.1 1.2 1.5 4.2 4.3 7.2 7.3

M	P mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	□ a mm	l ₃ mm	z	↔	e-Code
12	1,75	110	23	9	7,0	10	3	10.3	E263M12
14	2,00	110	25	11	9,0	12	3	12	E263M14
16	2,00	110	25	12	9,0	12	3	14	E263M16
18	2,50	125	30	14	11,0	14	3	15.5	E263M18
20	2,50	140	30	16	12,0	15	3	17.5	E263M20
22	2,50	140	34	18	14,5	17	4	19.5	E263M22
24	3,00	160	38	18	14,5	17	4	21	E263M24
27	3,00	160	38	20	16	19	4	24	E263M27
30	3,50	180	45	22	18,0	21	4	26.5	E263M30
33	3,50	180	50	25	20,0	23	4	29.5	E263M33
36	4,00	200	55	28	22,0	25	4	32	E263M36